

Dual Service Center informiert Dual Service Center informs



31. Jan. 1992

Datum/Date

Zeichen/Ref.-Nr.

Geräte-Nr./Serial number

14.01.1992

KD/Di-hk

A/207

Für Ihre Werkstatt
For your workshop

CT 7040 CT 7065
CT 7060 CR 9065 RC

Download from www.dual.de
Not for commercial use

Erscheinung: Beim Einschalten des Gerätes kann es vorkommen, daß ein Abstimmen der Sender nicht möglich ist. Kein Ton, nur Rauschen, Frequenzanzeige in Ordnung.

Achtung: Fehler kann auch nur zeitweise auftreten.

Ursache : Quarz schwingt nicht oder nicht korrekt. Dadurch keine Abstimmspannung.

Abhilfe : Quarz 4 MHz auf der Tunerplatte wechseln (IC 601 Pin 17), Art. Nr. 274 729.

Fault : When switching on the appliance there can occur that an adjusting of the transmitters is not possible. No sound, only noise, frequency indication is in order.

Attention: Fault can also appear only temporarily.

Cause : Quarz doesn't swing or not correctly. Therefore, no adjustment voltage.

Remedy : Quarz 4 MHz on the tuner board is to be changed (IC 601 pin 17), part no. 274 729.